STANDARD INSTRUMENT ARRIVAL CHART
(STAR) - ICAO

TRANSITION LEVEL by ATC
TRANSITION ALTITUDE *7000*

GENEVA LSGG
STAR RWY 04 - RNAV
BENOT - FRIBU - ULMES

COMMUNICATION FAILURE PROCEDURE

- Set transponder on code 7600.
- If on final intercept or cleared for the approach, continue as instructed and follow the IAC.
- In any other case, proceed direct to GEVEA at last assigned and acknowledged FL.
- When in the GEVEA HLDG pattern descend or climb to FL100.
- If RWY 04 is in use, leave GEVEA HLDG at FL100 and proceed via PITOM, GG502 (MAX IAS 220kt) to INDIS and carry out an instrument approach according to IAC. Cross PITOM at or above FL080, GG502 at or above *7000*.
- If RWY 22 is in use, leave GEVEA HLDG at FL100 and proceed via GG525, GG512 (MAX IAS 220kt) to SAPRE and carry out an instrument approach according to IAC. Cross GG525 at or above FL080, GG512 at or above *7000*.
- For ACFT equipped with onboard telephone, dial +41 22 798 7600 and mention last RTF channel used.

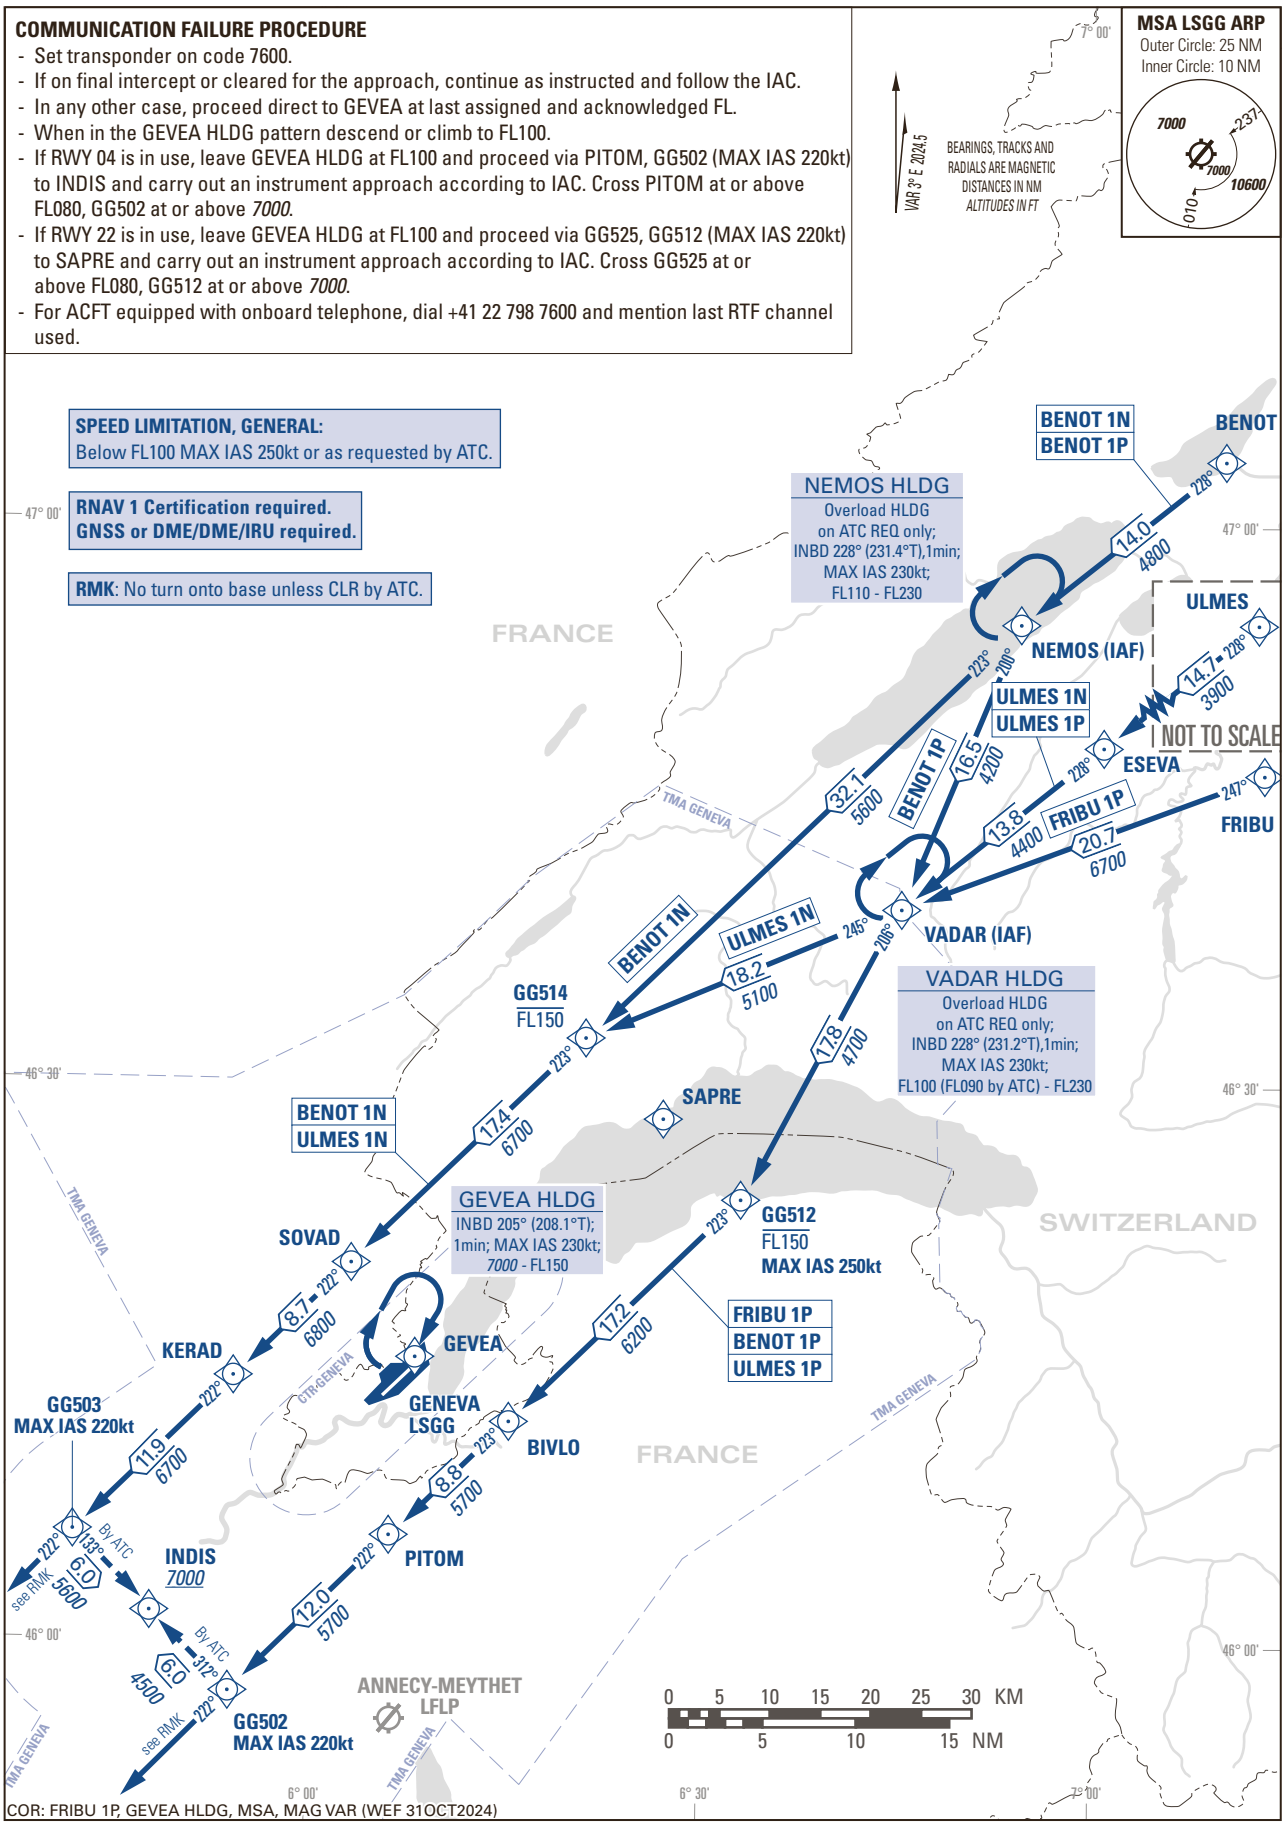

COR: FRIBU 1P, GEVEA HLDG, MSA, MAG VAR (WEF 31OCT2024)

THIS PAGE INTENTIONALLY LEFT BLANK