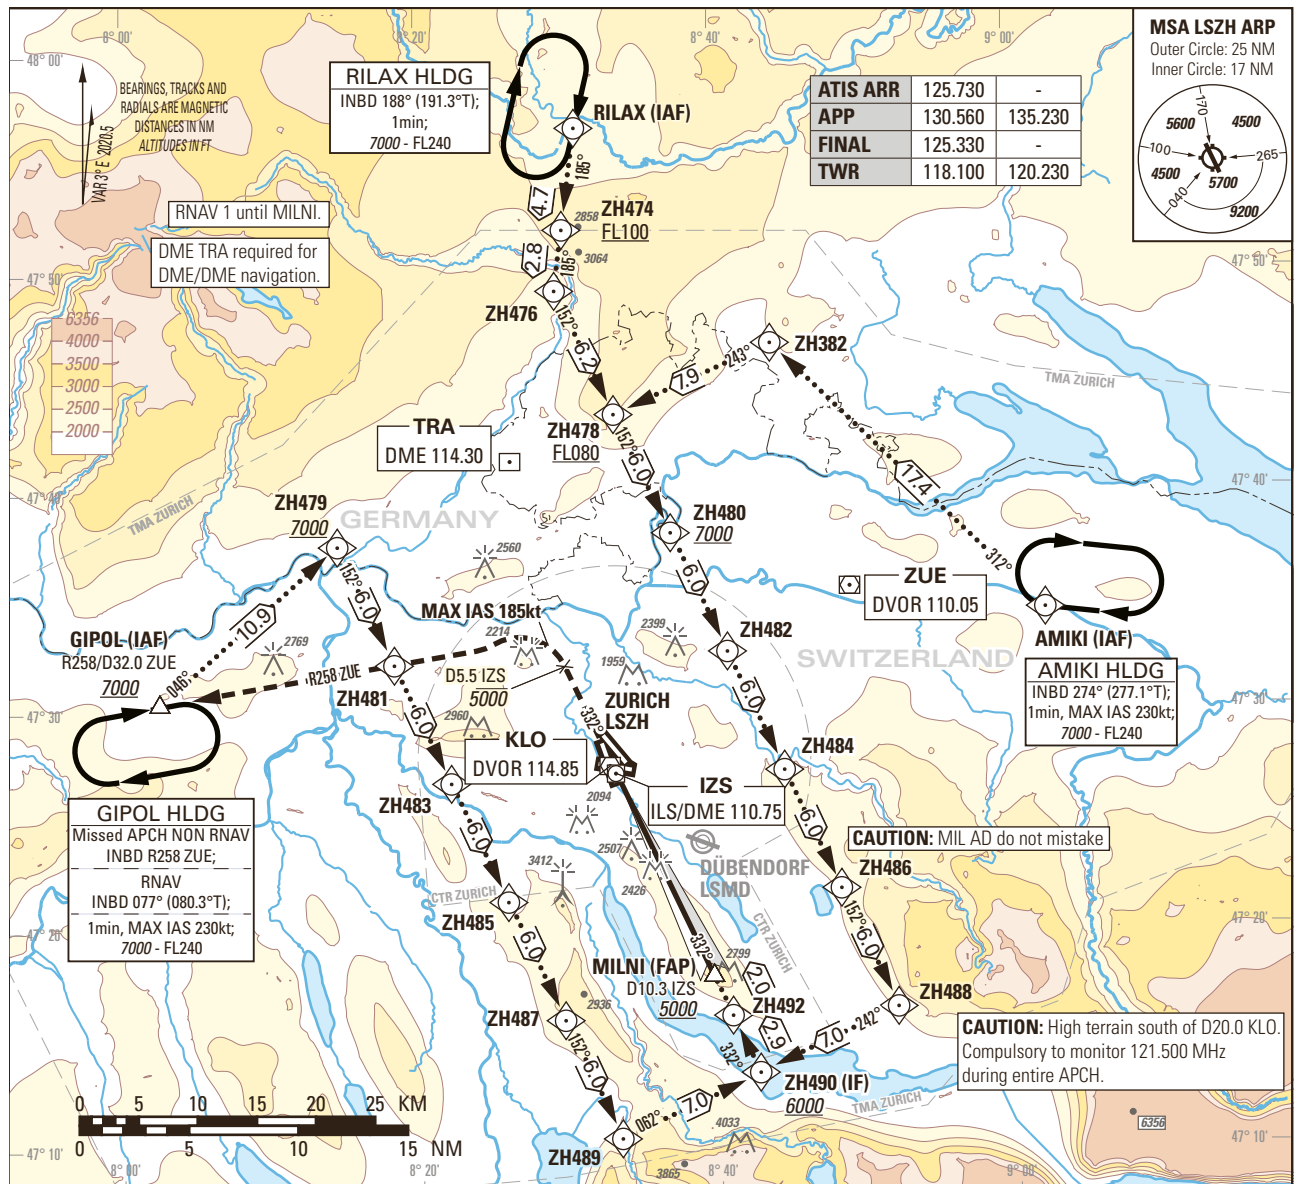


Instrument Approach Chart
(IAC) - ICAO


AD ELEV 1417ft

TRANSITION LEVEL by ATC
TRANSITION ALTITUDE 7000ZURICH LSZH
ILS RWY 34**MISSED APPROACH**

Initial climb clearance 5000.

Climb straight ahead. At D5.5 IZS past the station turn left (MAX IAS 185kt during turn) and intercept R258 ZUE. Continue climb to 7000. Proceed to GIPOL.

Cross D5.5 IZS at or below 5000.
Cross GIPOL at or above 7000.

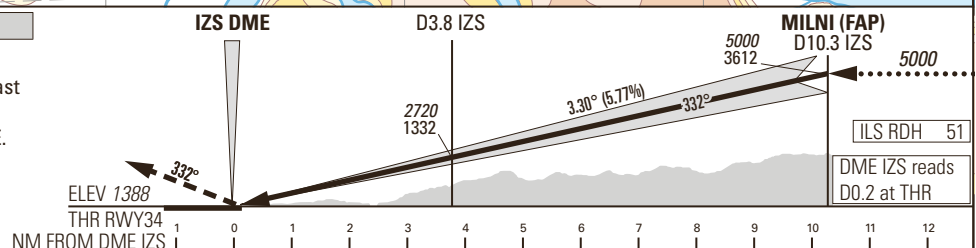

Missed APCH climb gradient requirement		STRAIGHT-IN APPROACH					ROD				
		A	B	C	D	D _L					
		OBSTACLE CLEARANCE ALTITUDE (HEIGHT)									
2.5%	pressure altimeter	1592 (204)	1602 (214)	1615 (227)	1625 (237)		GS kt	90	110	130	150
2.8% to 2200	pressure altimeter	1543 (155)	1552 (164)	1560 (172)	1571 (183)	1572 (184)	FT/MIN	526	642	759	876
		DECISION ALTITUDE (HEIGHT)									
2.8% to 2200	pressure altimeter	1588 (200)									
IZS DME		2	3	4	5	6	7	8	9	10	
RECOMMENDED CROSSING ALTITUDE (HEIGHT)		2090 (700)	2440 (1050)	2790 (1400)	3140 (1750)	3490 (2100)	3840 (2450)	4190 (2800)	4540 (3150)	4890 (3500)	

COR: completely revised
(WEF 03OCT2024)

THIS PAGE INTENTIONALLY LEFT BLANK