
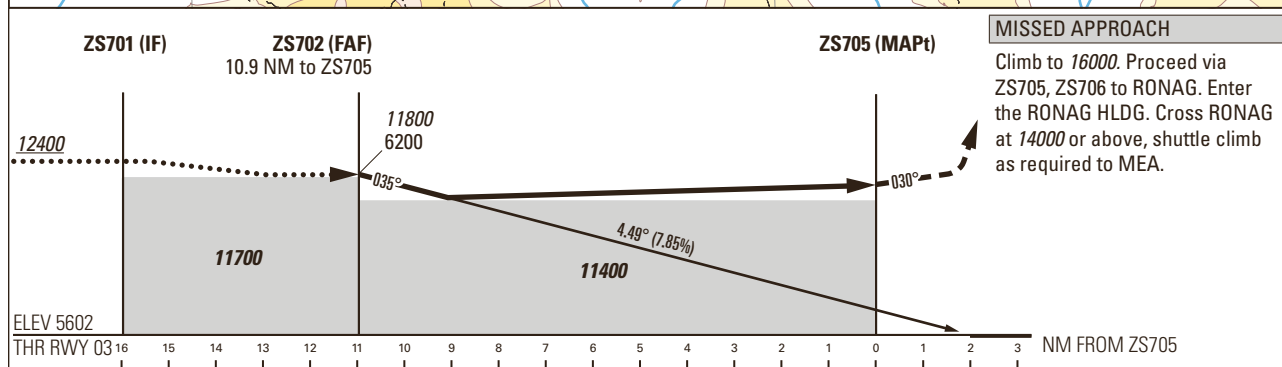


SAMEDAN LSZS
VISUAL APCH WITH RNP GUIDANCE RWY 03
9.1° OFFSET LEFT
ACFT CAT A/B/C

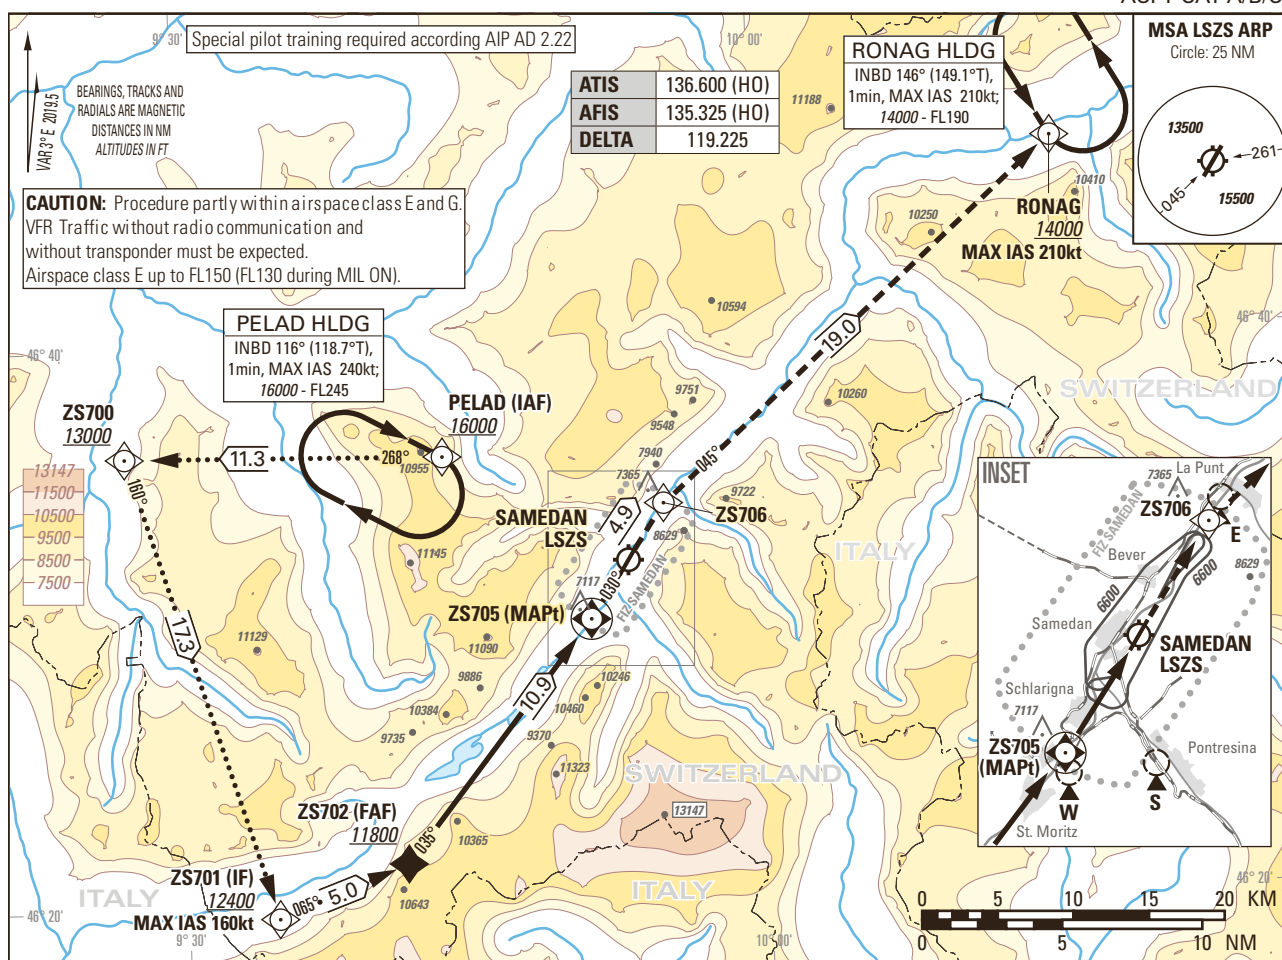

Missed APCH climb gradient requirement	NON-ALIGNED VISUAL APCH WITH RNP TRACK GUIDANCE		
	A	B	C
	MDA(H)		
2.5%	11400 (5798)		

In case of communication failure after having passed the IAF:

- Set transponder on 7600.
- Continue approach.
- In case of missed approach perform two HLDG patterns at RONAG.
- If radio contact is not re-established, proceed to ALTN AD.

ROD	GS kt	80	100	120	140	160	180	
	FT/MIN	636	795	954	1113	1272	1431	
	DIST ZS705	10.9	10	9	8	7	5	
	DIST THR	12.9	12	11	10	9	7	
	ALT FT	11800	11370	10890	10420	9940	9460	8980

- ROD 1000ft/min exceeded with GS > 125kt in final approach.
- Approach clearance includes the clearance to leave and re-enter controlled airspace.
- ICAO obstacle protection surface penetrated by a hill BTN ZS705 and THR 03.
- PAPI at 4.49°

- Altitude adjustments for cold temperature conditions required by the flight crew.

COR: new chart (WEF 05DEC2019)

THIS PAGE INTENTIONALLY LEFT BLANK