
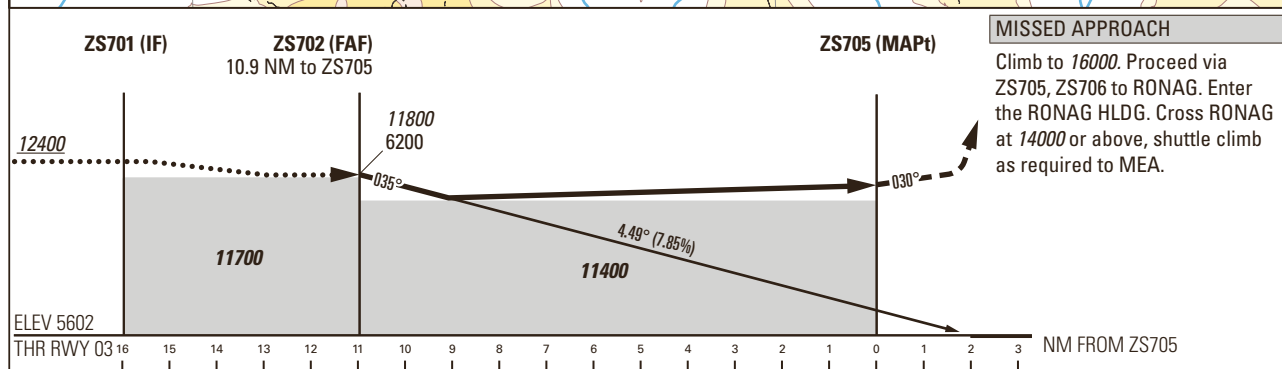


SAMEDAN LSZS
VISUAL APCH WITH RNP GUIDANCE RWY 03
9.1° OFFSET LEFT
ACFT CAT A/B/C

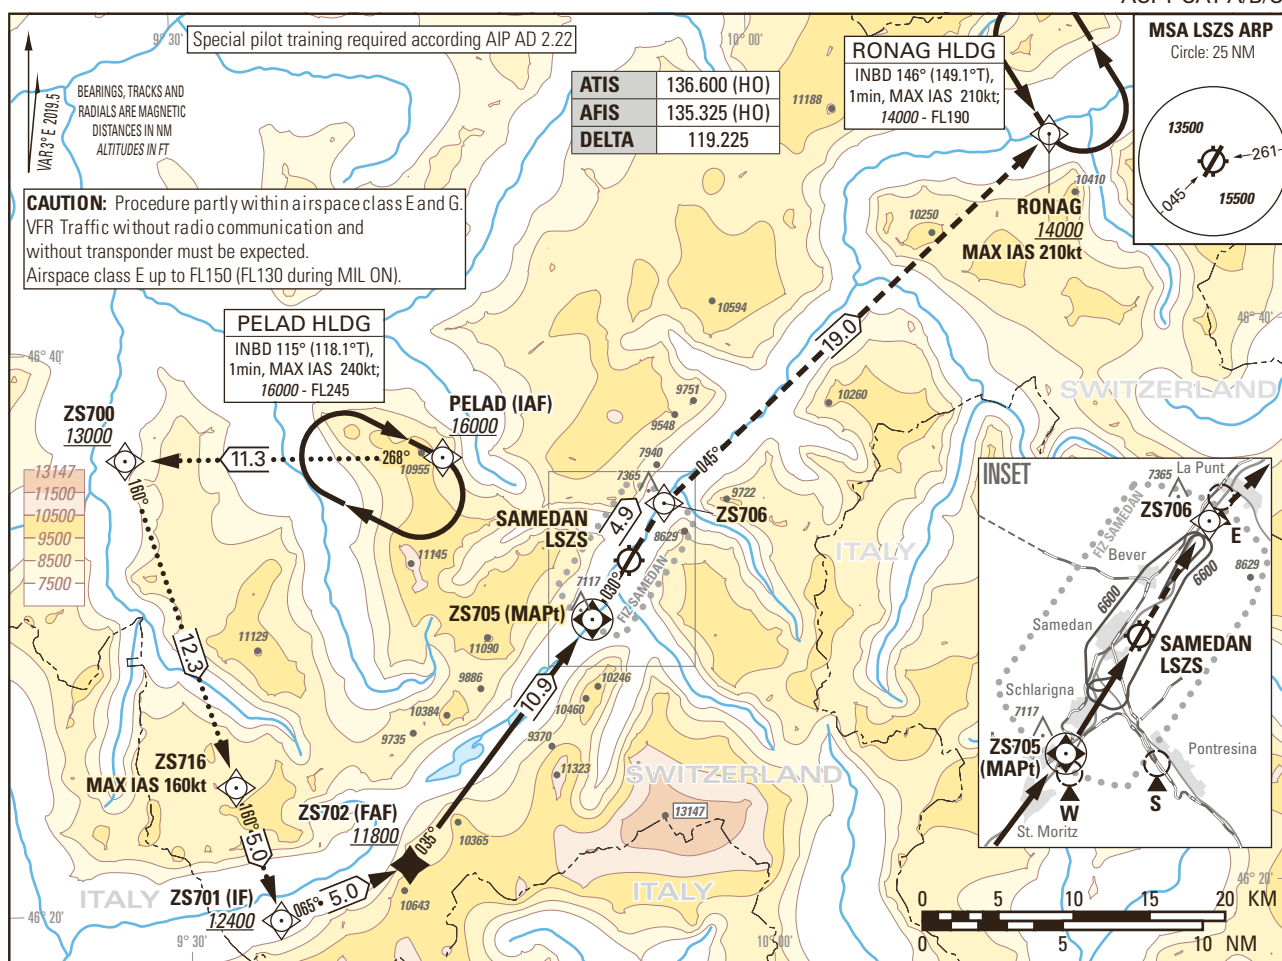

Missed APCH climb gradient requirement	NON-ALIGNED VISUAL APCH WITH RNP TRACK GUIDANCE		
	A	B	C
	MDA(H)		
2.5%	11400 (5798)		

ROD	GS kt	80	100	120	140	160	180	
	FT/MIN	636	795	954	1113	1272	1431	
	DIST ZS705	10.9	10	9	8	7	6	5
	DIST THR	12.9	12	11	10	9	8	7
	ALT FT	11800	11370	10890	10420	9940	9460	8980

COMMUNICATION FAILURE PROCEDURE

ALTN AD.

REMARK

- ROD 1000ft/min exceeded with GS > 125kt in final approach.
- Approach clearance includes the clearance to leave and re-enter controlled airspace.
- ICAO obstacle protection surface penetrated by a hill BTN ZS705 and THR 03.
- PAPI at 4.49°

CAUTION

- Altitude adjustments for cold temperature conditions required by the flight crew.

COR: ZS716 added (WEF 03NOV2022)

THIS PAGE INTENTIONALLY LEFT BLANK